
Manitowoc **Parts & Service Communicator**

Subject: S Model Dispenser Agitator Pin Change

Agitator pins required insertion in the correct direction to prevent ice from dislodging the pin. The previous version of the agitator pin could be inserted in the wrong direction and the pin would fall out. The current version has been designed to prevent incorrect insertion and also has an improved locking feature. This pin is the replacement part for all dispensers with front serviceable motors (serial number 610050366 or larger).

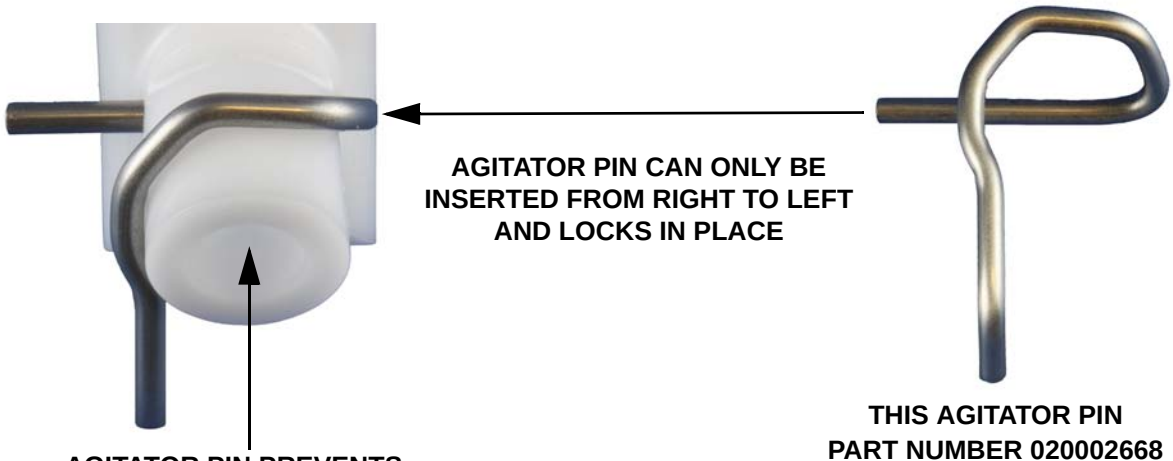

AGITATOR PIN CAN ONLY BE INSERTED FROM RIGHT TO LEFT AND LOCKS IN PLACE

AGITATOR PIN PREVENTS AGITATOR SHAFT FROM SHIFTING BACKWARD AND DISCONNECTING FROM MOTOR

THIS AGITATOR PIN PART NUMBER 020002668 REPLACES THE PREVIOUS VERSION

AGITATOR PIN REQUIRES INSERTION FROM RIGHT TO LEFT TO PREVENT ICE PRESSURE FROM DISLODGING PIN - THIS PIN STYLE IS REPLACED BY THE VERSION ABOVE THAT CAN NOT BE INSERTED INCORRECTLY

